

Date: Friday, 12/7/2007 10:21:29 AM
 User: Kfm Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : FWD TUBE ASSEMBLY
 Job Number : 36191
 Estimate Number : 10467
 P.O. Number :
 This Issue : 12/7/2007 S.O. No. :
 Prsht Rev. : NC Part Number : D3391021
 First Issue : / / Type : MACHINED PARTS Drawing Number : D3391 REV G
 Previous Run : 36190 Project Number : N/A
 Material :
 Due Date : 1/10/2008 Qty: 1 Um: Each
 Written By :
 Checked & Approved By : 07.12.07
 Comment : Est. A 05.09.13 New issue KJ/JLM
 Est. B 06.02.10 Dwg rev.D ecn 773 EC
 Est. C 06.05.02 Added inspections EC
 est D 07.03.13 rev F dwg EC
 est E 07.11.07 revG dwg ecn1053P EC verified by: DD
 Est Rev:f ECN 1056 07-11-12 DD verified by: EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 D6013047 SKIDTUBE MAT'L



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

SKIDTUBE MAT'L

Pick:

Qty Part Number Description Batch

1 D6013-047 Extrusion B26547 Q.M 08.01.09 ①

2.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Cut extrusion to 46.52 +0.010 -0.020

Q.M 08.01.09 ①

3.0 BENDING BENDING MACHINE



Comment: No bender

Bend as per Dwg D3391 Using Bend Prog 3391021

EL / JD 8-1-16

4.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

5 08/02/10 ①

5.0 HAAS1 HAAS CNC VERTICAL MACHINING #1



Comment: HAAS CNC VERTICAL MACHINING #1

1-Machine as per Folio FA590 Rev. AA & Dwg D3391 Rev. G

Identify as D3391-1

WZ 08/02/10 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 12/7/2007 10:21:29 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 36191

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Deburr

6.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

ml 08/07/16

(B)

7.0

MILLING CONV.

CONVENTIONAL MILLING MACHINE



Comment: CONVENTIONAL MILLING MACHINE

Drill X1 Aft cap as per Dwg D3391 .1875" dia

ml 08/07/16

(B)

8.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

ml 08/07/16

(B)

9.0

QC8

SECOND CHECK



Comment: SECOND CHECK

ml 08/07/16 (X)

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill float bag holes as per Dwg D3391 using DT8798(Do not open tow cap holes to finish size)
(ONLY DRILL HOLES MARKED "A")

2-Drill Remaining two holes for tow cap using DT 8819 Locating off of .1875" holes drilled in previous step

3-Open tow cap holes to .208" as per Dwg D3391

4-Open Tow Ring hole to .640" as per Dwg D3391

5-Deburr & Scribe Batch number Inside aft end.

AD
8-7-17

11.0

QC5

INSPECT WORK TO CURRENT STEP ,



Comment: INSPECT WORK TO CURRENT STEP

ml 08/07/16 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D 3391-021 PAR #: _____ Fault Category: Prod / x-tube NCR: Yes No DQA: D Date: 08/08/14

QA: N/C Closed: _____ Date: _____

NCR: <u>36191</u>		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
<u>08/07/22</u>	<u>1</u>	<u>During drilling of the wear plate holes the employee was confused as to what where to place the Drill Sing 1 ¹⁰⁵⁵⁰</u>	<u>[Signature]</u>	<u>Scrap 2 destroyed part Qty 1</u>	<u>BE 08-07-22</u>	<u>[Signature]</u>	<u>[Signature]</u>	<u>[Signature]</u>
<u>000</u>	<u>15</u>	<u>seeing the correct hole to locate the Drill Sing and placed it in the wrong location.</u>	<u>[Signature]</u>			<u>[Signature]</u>	<u>[Signature]</u>	<u>[Signature]</u>
<u>000</u>	<u>40502</u>	<u>R.C. employee got confused,</u>	<u>[Signature]</u>			<u>[Signature]</u>	<u>[Signature]</u>	<u>[Signature]</u>
<u>D 3391-023</u>		<u>inadequate training.</u>						

NOTE: Date & initial all entries

Date: Friday, 12/7/2007 10:21:30 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 36191

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

14.0

D36704200

SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

SPACER

batch: _____

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- instal spacers as per dwg D3391

A/R Magnabond 6398 batch: _____

exp. date: _____

cure time 12hrs. as per QSI015

2- grind crossbolt flush

3-back drill crossbolt if necessary

SCU 14P

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 12/7/2007 10:21:30 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 36191

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

ALS41032130

Insert



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

INSERT

batch: _____

or equivalent

per QSI 017

20.0

ALS41032225

Insert



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

INSERT

batch: _____

or equivalent

per QSI 017

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Inserts as per Dwg

22.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

23.0

D3401041

Tow Cap Assembly



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Tow Cap Assembly

Pick:

Qty Part Number Description Batch

1 D3401-041 Tow Cap _____

24.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

25.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 12/7/2007 10:21:30 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FWD TUBE ASSEMBLY

Job Number: 36191

Part Number: D3391021

Job Number:



Seq. #:

Machine Or Operation:

Description :

26.0

D36721

PHENOLIC WASHER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)
PHENOLIC WASHER

27.0

AN3C4A

BOLT



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)
Bolt
Pick:
Qty Part Number Description Batch
4 AN3C4A Bolt

28.0

AN960C10L

washer



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)
washer

29.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1
Install tow Cap as per Dwg D3391
Identify as D3391-021

30.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP
Inspect thread of each insert using DT8821

31.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1
Identify and Stock
Location: _____

32.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



Handwritten signature


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

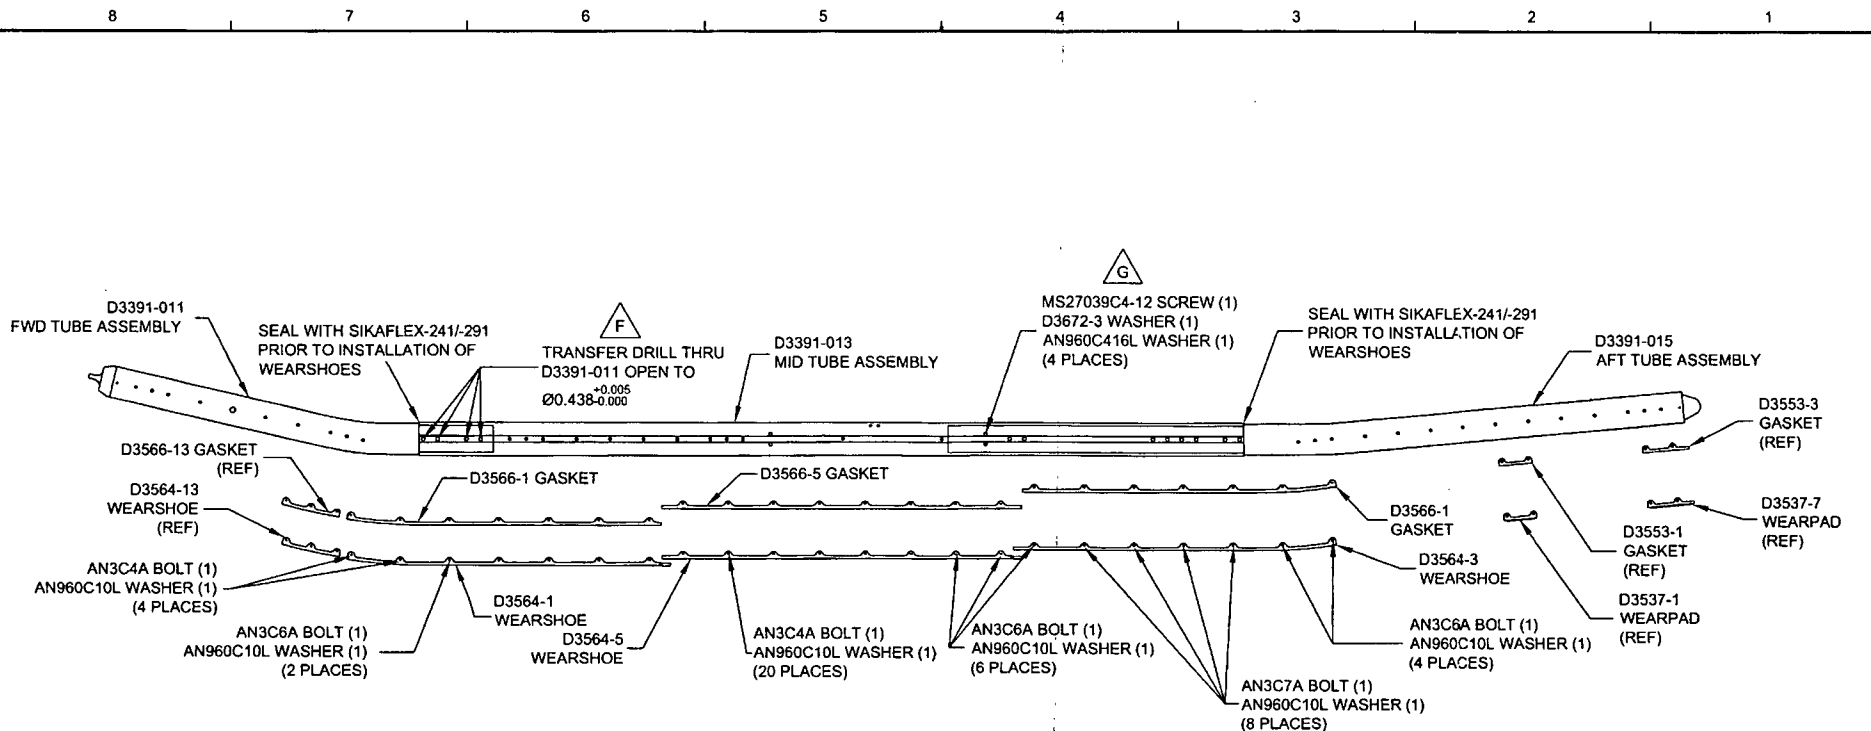

RELEASED
07.11.06

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL 0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	07.07.31		


DART AEROSPACE USA, INC
PORT HADLOCK, WA

DRAWING NO. D3391
REV. G
SHEET 1 OF 8

TITLE 412 FLOAT SKIDTUBE
SCALE NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

WORK ORDER
NO. 30191
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

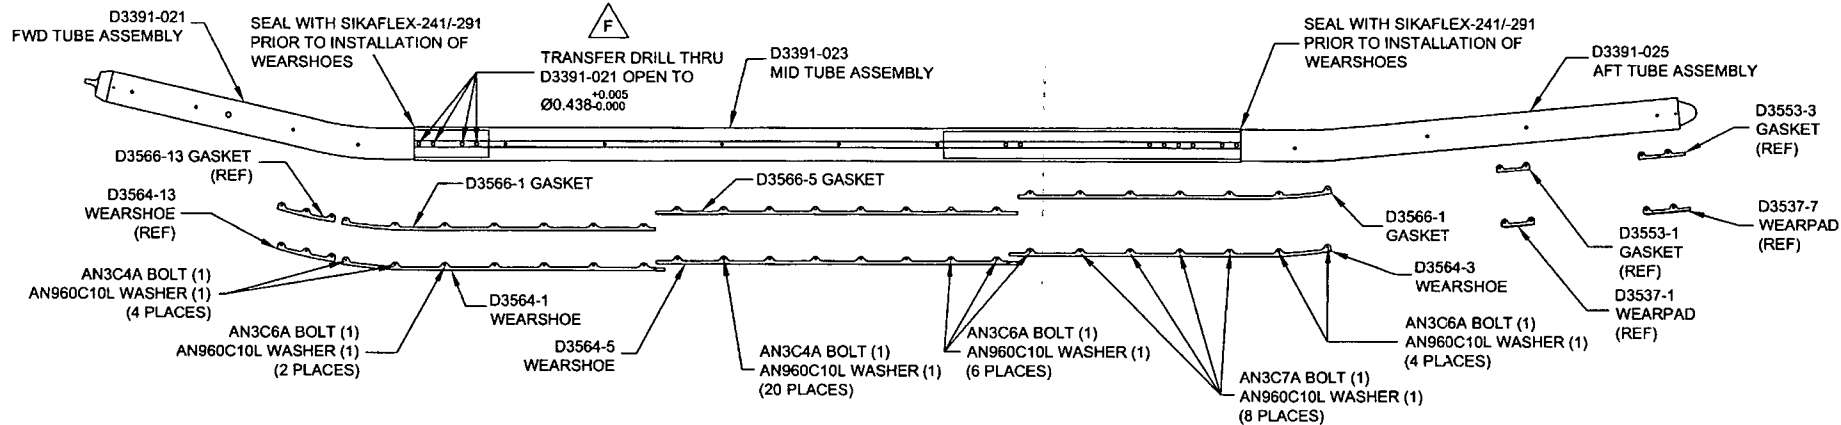

D3391-043 ASSEMBLY

RELEASED
07.11.94

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.

DESIGN	<i>PH</i>	DART AEROSPACE USA, INC
DRAWN	<i>SLC</i>	PORT HADLOCK, WA
CHECKED	<i>SLC</i>	DRAWING NO. REV. G
MFG. APPR.	<i>SLC</i>	D3391 SHEET 2 OF 8
APPROVED	<i>SLC</i>	TITLE SCALE
DE APPR.	<i>SLC</i>	412 FLOAT SKIDTUBE NTS
DATE	07.07.31	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC


NO. 26791
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

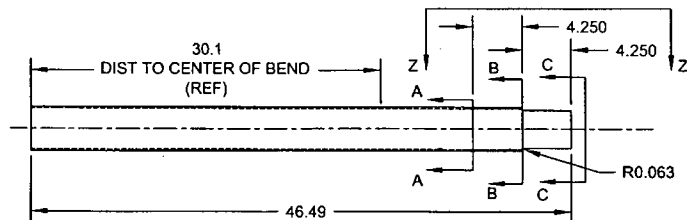


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

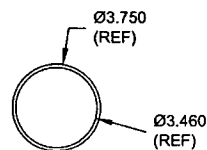


SECTION A-A
(SCALE 1:5)

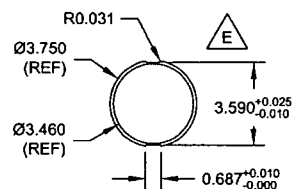


SECTION B-B
(SCALE 1:5)

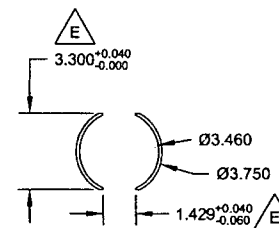

SECTION C-C
(SCALE 1:5)

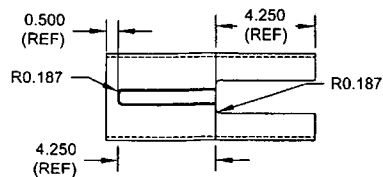

VIEW Z-Z
(SCALE 1:5)

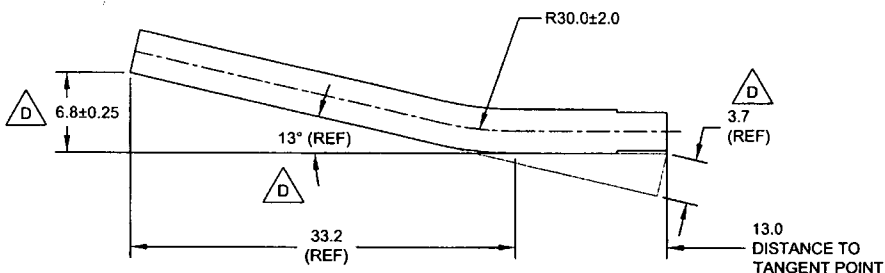



D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

RELEASED
07-11-26 MP

NO. 36141
WORK ORDER
SUBJECT TO AVIATION
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
NO. 36141


DESIGN	GH	DART AEROSPACE USA, INC	
DRAWN	SC	PORT HADLOCK, WA	
CHECKED	SC	DRAWING NO.	REV. G
MFG. APPR.	SC	D3391	SHEET 3 OF 8
APPROVED	SC	TITLE	SCALE
DE APPR.	SC	412 FLOAT SKIDTUBE	1:10
DATE	07.07.31	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIES OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

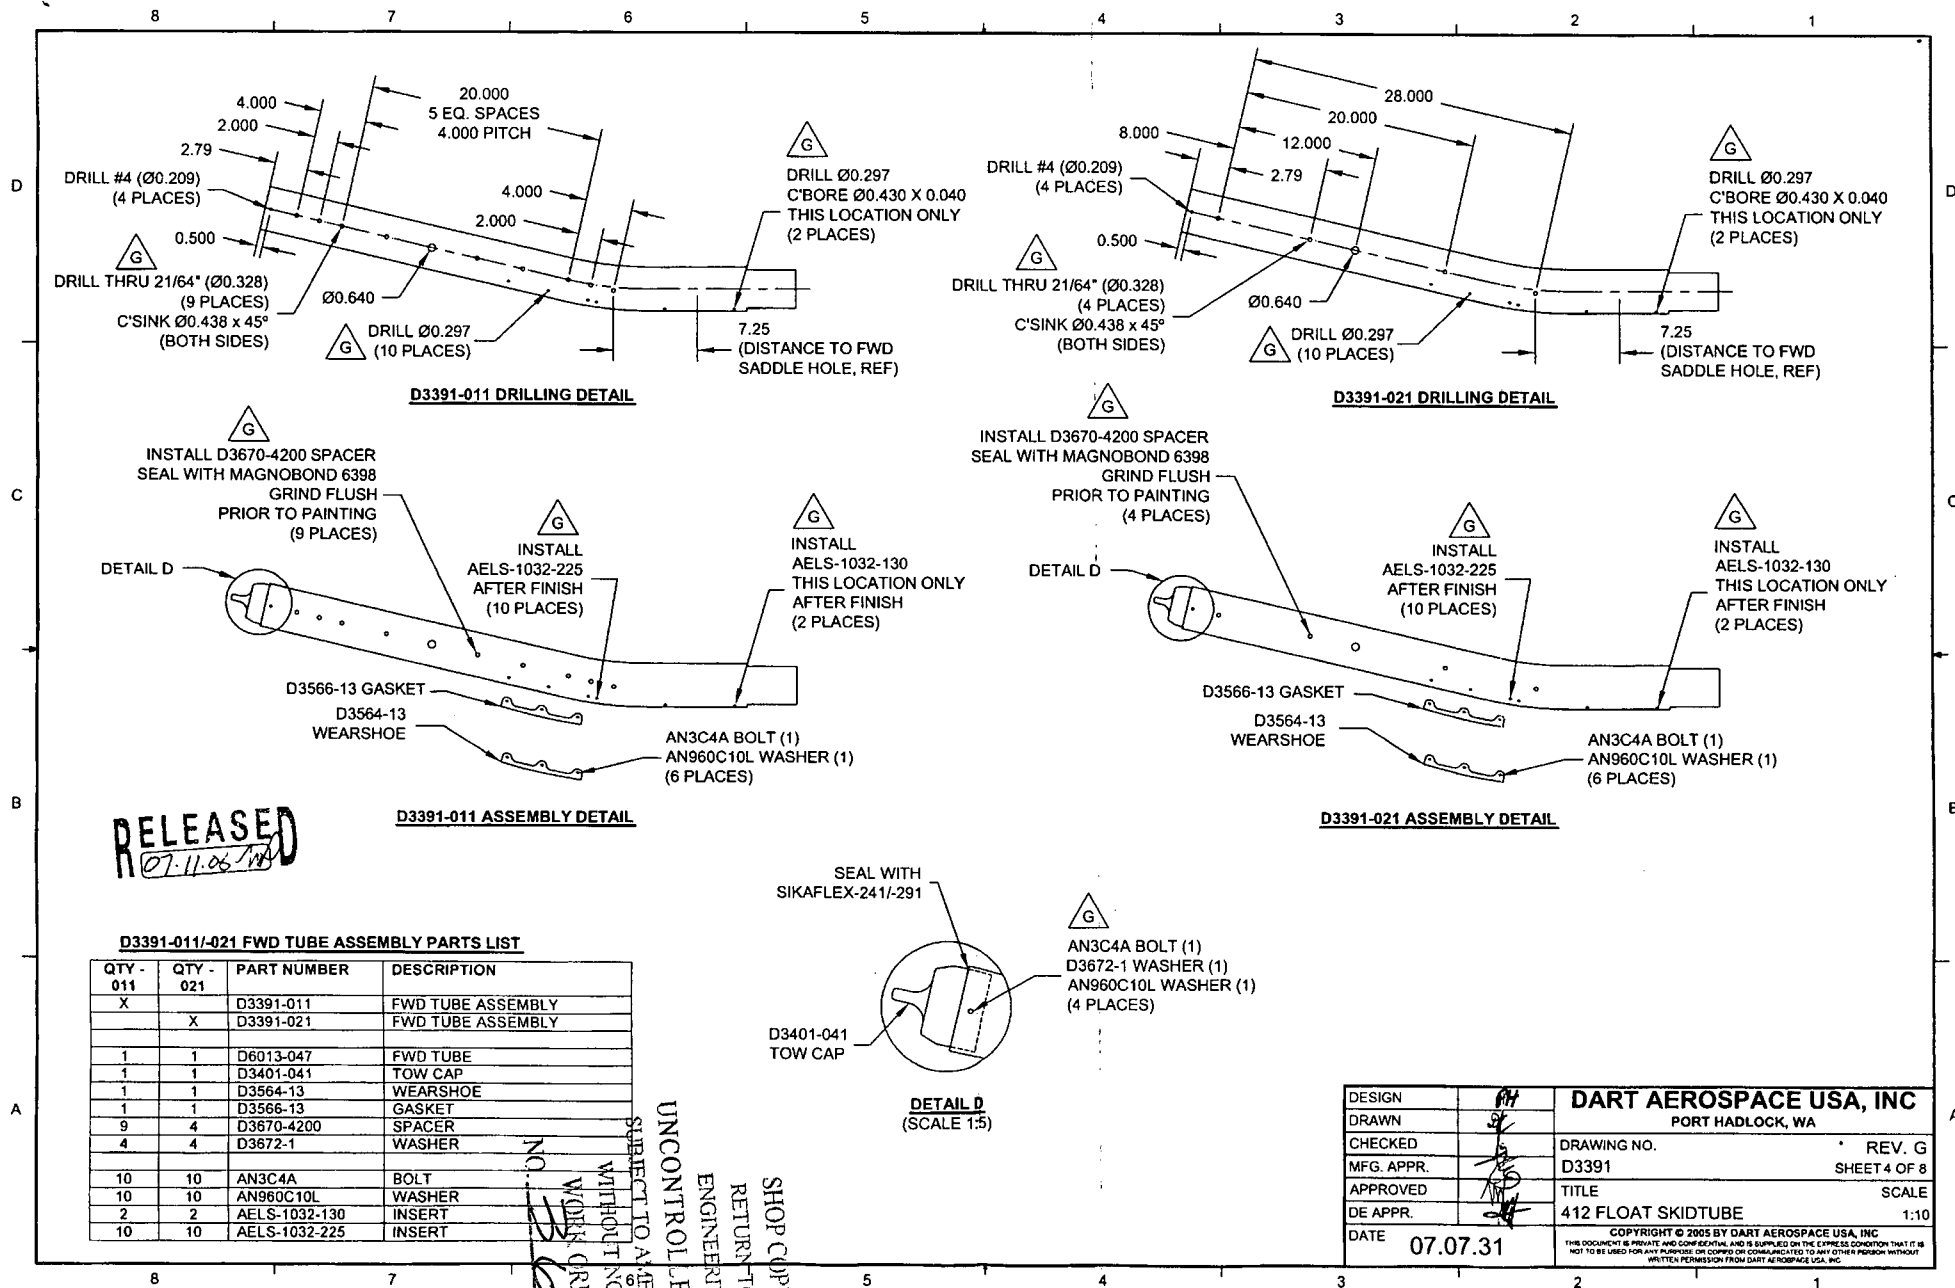

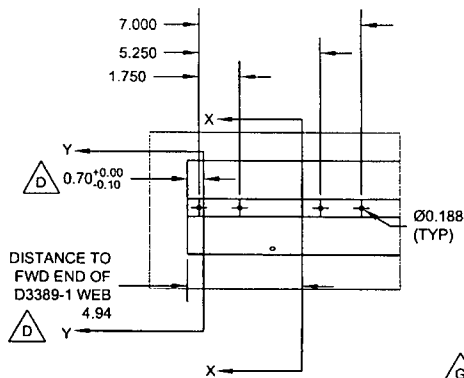


DETAIL J
(SCALE 1:5)


DRILL THRU 21/64" (Ø0.328)
C'SINK Ø0.438 X 45° (BOTH SIDES)
(12 PLACES)

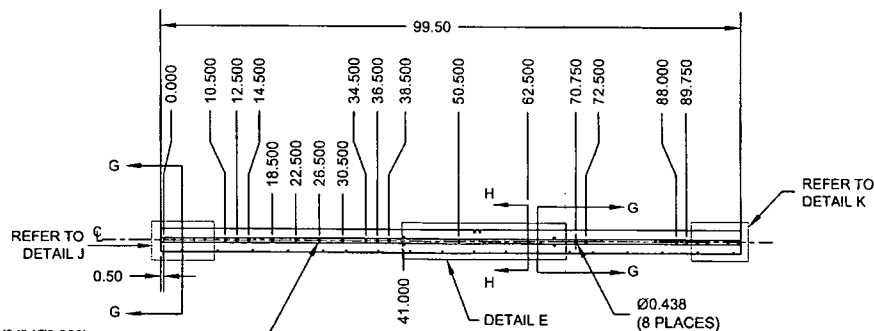


D3391-013 ASSEMBLY DETAIL

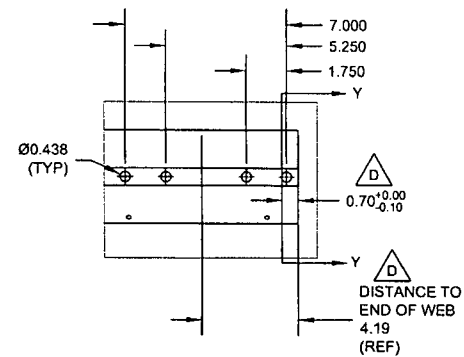


DETAIL K
(SCALE 1:5)

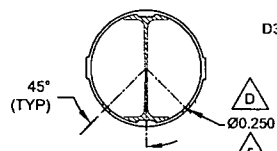


SECTION G-G
(SCALE 1:4)

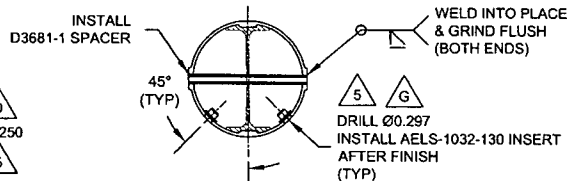

SECTION H-H
(SCALE 1:4)

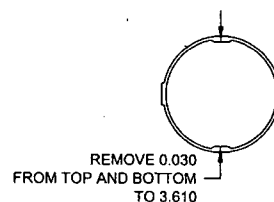


SECTION X-X
(SCALE 1:4)

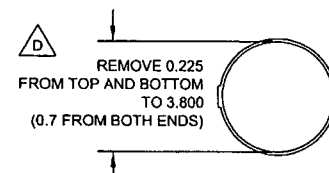


SECTION Y-Y
(SCALE 1:4)

DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
(TYP 4 PLACES)

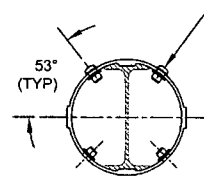


SECTION M-M
(SCALE 1:4)

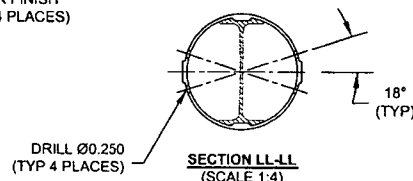


SECTION LL-LL
(SCALE 1:4)

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
12	D3681-1	SPACER
4	D3672-1	WASHER
4	D3672-3	WASHER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

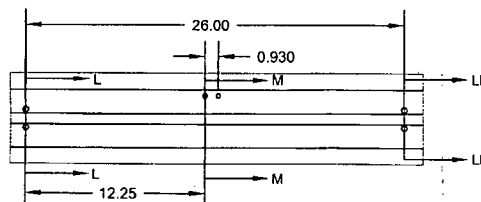

DETAIL E
(SCALE 1:8)

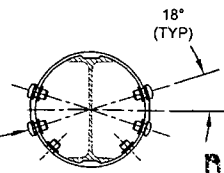

SECTION L-L
(SCALE 1:4)


DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
(TYP 4 PLACES)


RELEASED
27-11-2017


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	DP	PORT HADLOCK, WA	
CHECKED	JP	DRAWING NO.	REV. G
MFG. APPR.	JP	D3391	SHEET 5 OF 8
APPROVED	JP	TITLE	SCALE
DE APPR.	JP	412 FLOAT SKIDTUBE	1:20
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

- D3391-013 MID TUBE ASSEMBLY
- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
 - 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX 2301 PER QSI 004
 - 3) WELDING: PER DART QSI 004


NO. 3619
WORK ORDER
UNCONTROLLED COPY
ENGINEERING
SUBJECT TO AMENDMENT
WITHOUT NOTICE
RETURN TO
COPY
TO COPY

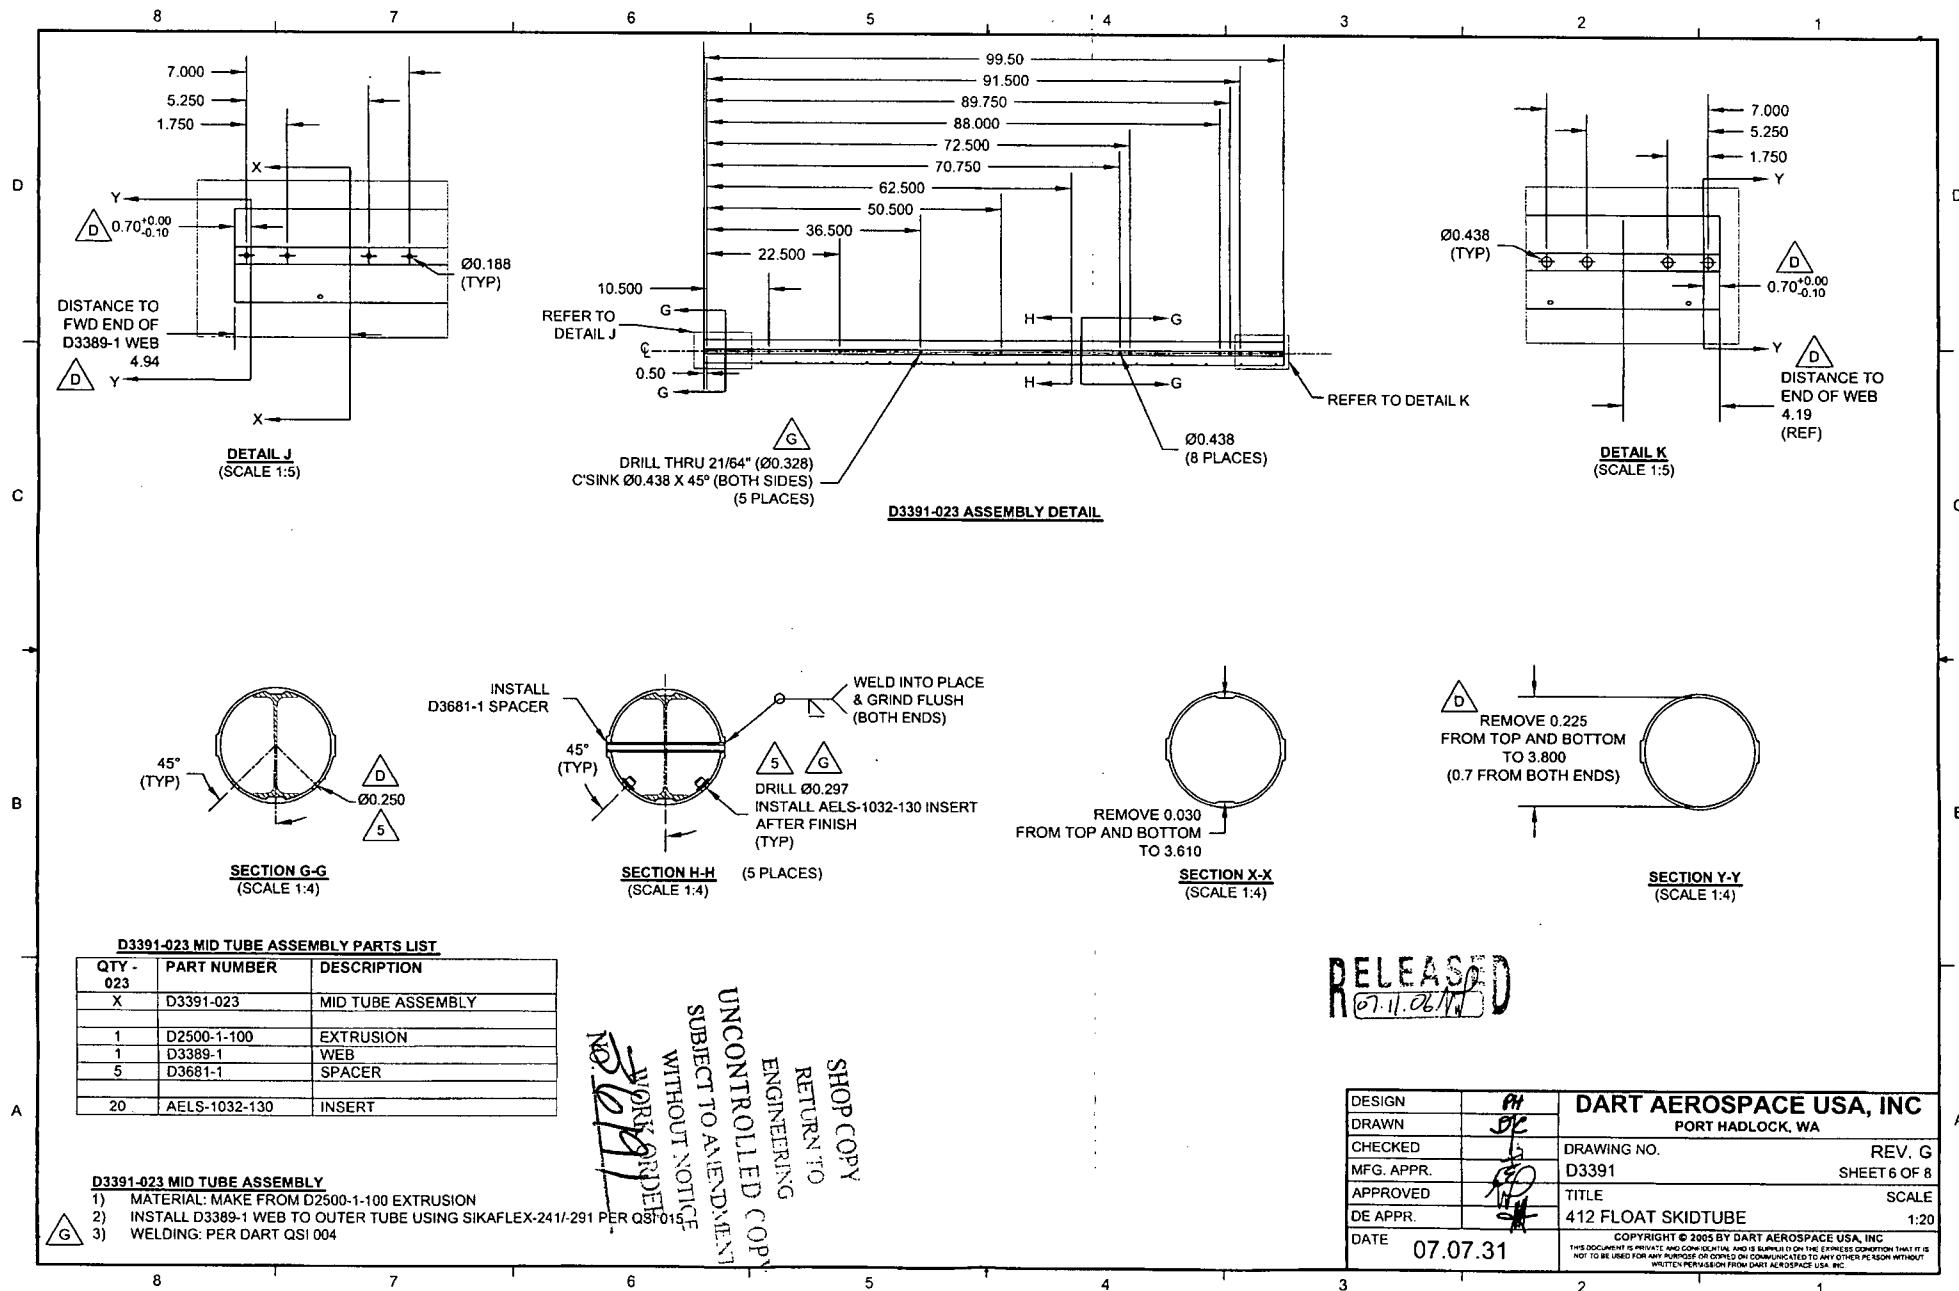

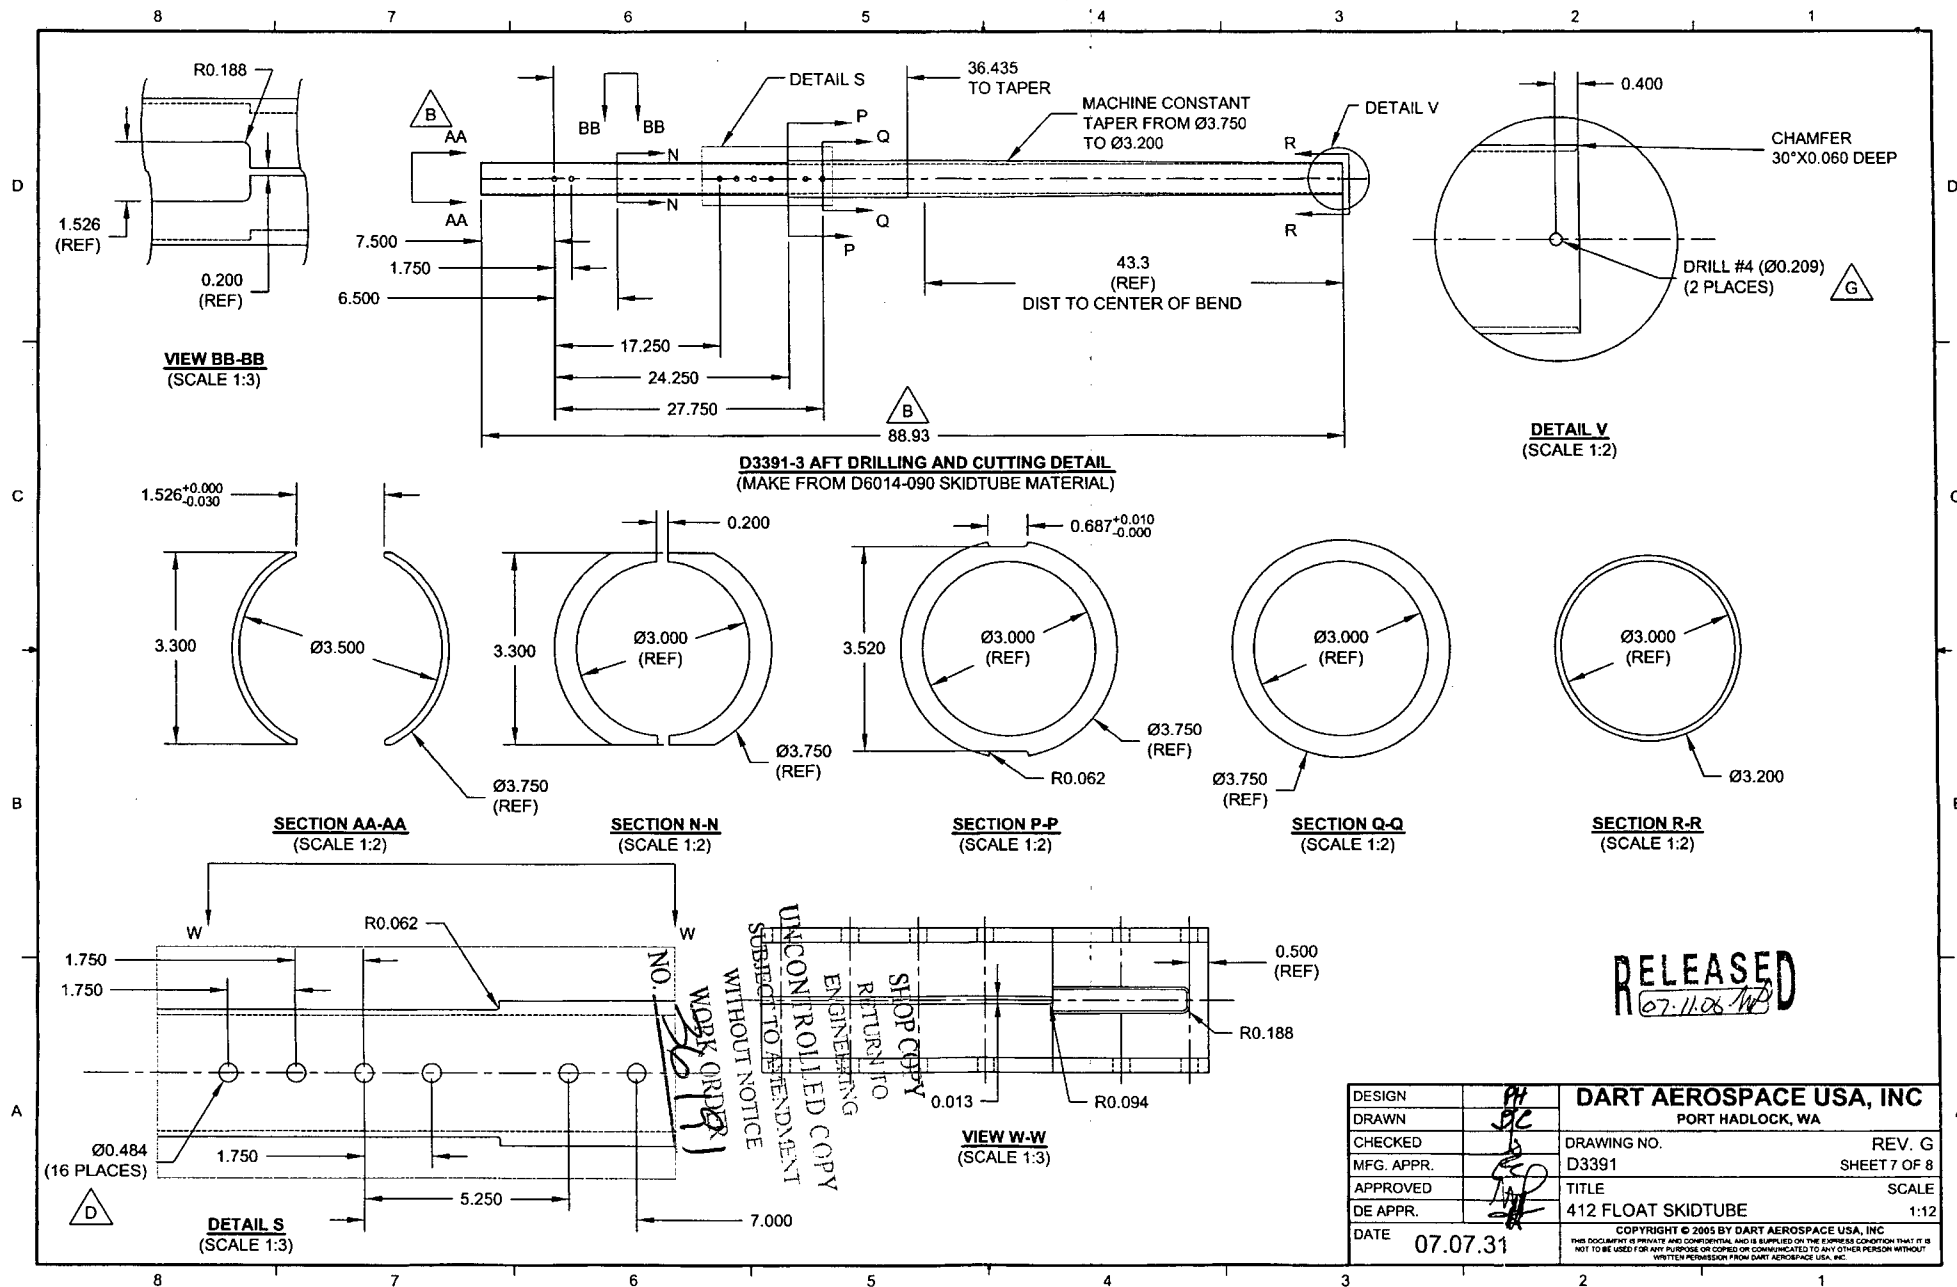

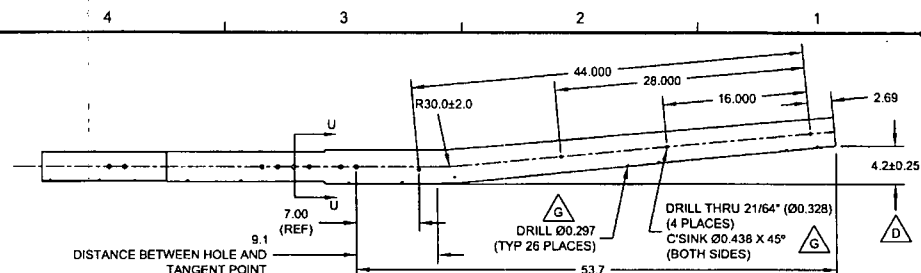


D3391-025 BENDING AND DRILLING DETAIL
(SEE C'BORE DETAIL BELOW)

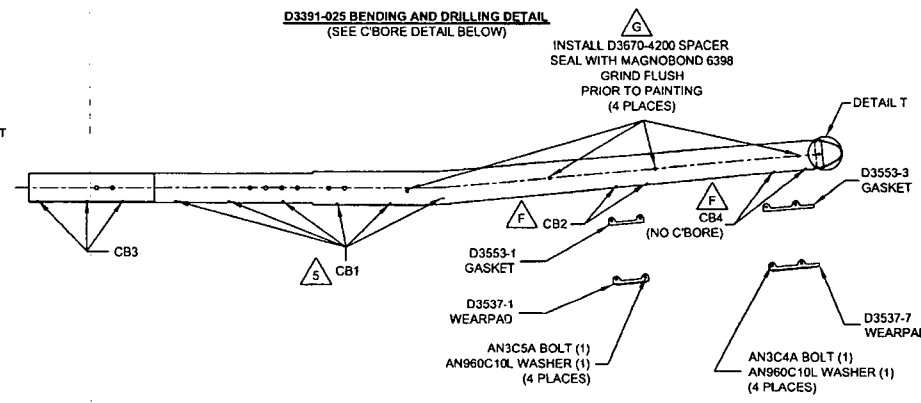


D3391-025 ASSEMBLY AND C'BORE DETAIL
(SEE TABLE)

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X		D3391-015	AFT TUBE ASSEMBLY
	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4		ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10I	WASHER

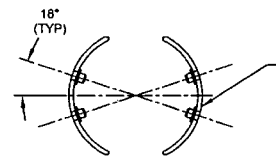

SECTION CC-CC
(SCALE 1:3)

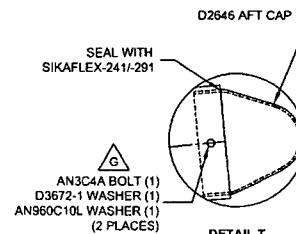

DETAIL T
(SCALE 1:3)

RELEASE
07.11.06

HOLES MARKED	QTY D3391-015	QTY D3391-025	C'BORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 26191

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	DL	PORT HADLOCK, WA	
CHECKED	DL	DRAWING NO.	REV. G
MFG. APPR.	DL	D3391	SHEET 8 OF 8
APPROVED	DL	TITLE	SCALE
DE APPR.	DL	412 FLOAT SKIDTUBE	1:12
<p align="center">COPYRIGHT © 2005 BY DART AEROSPACE USA, INC</p> <p align="center">THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE UNDERSTANDING AND CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</p>			
DATE	07.07.31		

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON
WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.